

RACE TECH WP NITROGEN CHARGING TOOL

<IP TSNC 02.doc> PD 10-28-05

CAUTION – IMPROPER USE OF THIS TOOL CAN CAUSE BODILY HARM. READ AND UNDERSTAND INSTRUCTIONS BEFORE USE!


SPRING MUST BE REMOVED BEFORE MOUNTING THE TOOL ON THE SHOCK.

Tools needed: 6 mm Allen & TSNG 02


1. MOUNTING THE TOOL ON THE SHOCK RESERVOIR.

Loosen the V-clamps wide enough so they fit over the reservoir.

Slide the tool on until it stops on the reservoir cap.

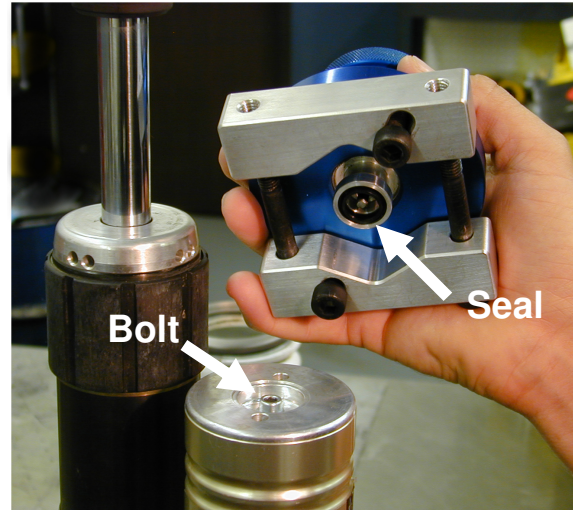

While pressing down on the tool body, tighten the clamps on the reservoir body evenly.

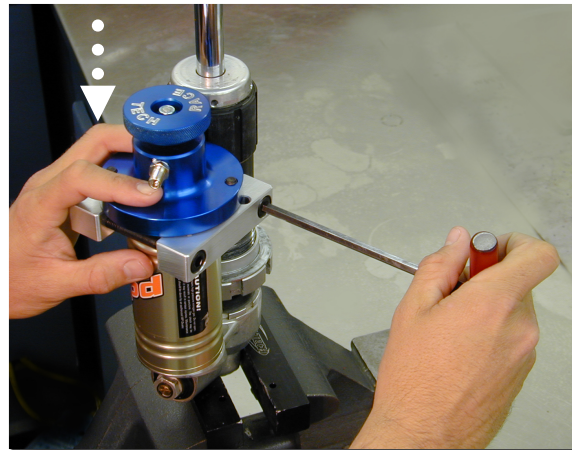

2. PRESSURIZING THE SHOCK

While pressing down on the knob loosen the reservoir allen bolt.

Install Race Tech's charging tool TSNG 02 to charge the shock.

After the shock is charged to the desired pressure, turn the knob clock-wise to tighten the allen bolt. Your shock is now pressurized.

Reverse order for removal.

